


Aisin AW 450-43LE

Parts shown here fit '98-later models of Isuzu NPR, GMC Forward Tiltmaster, Chevrolet Forward, Nissan UD and Mitsubishi Fuso trucks.



Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

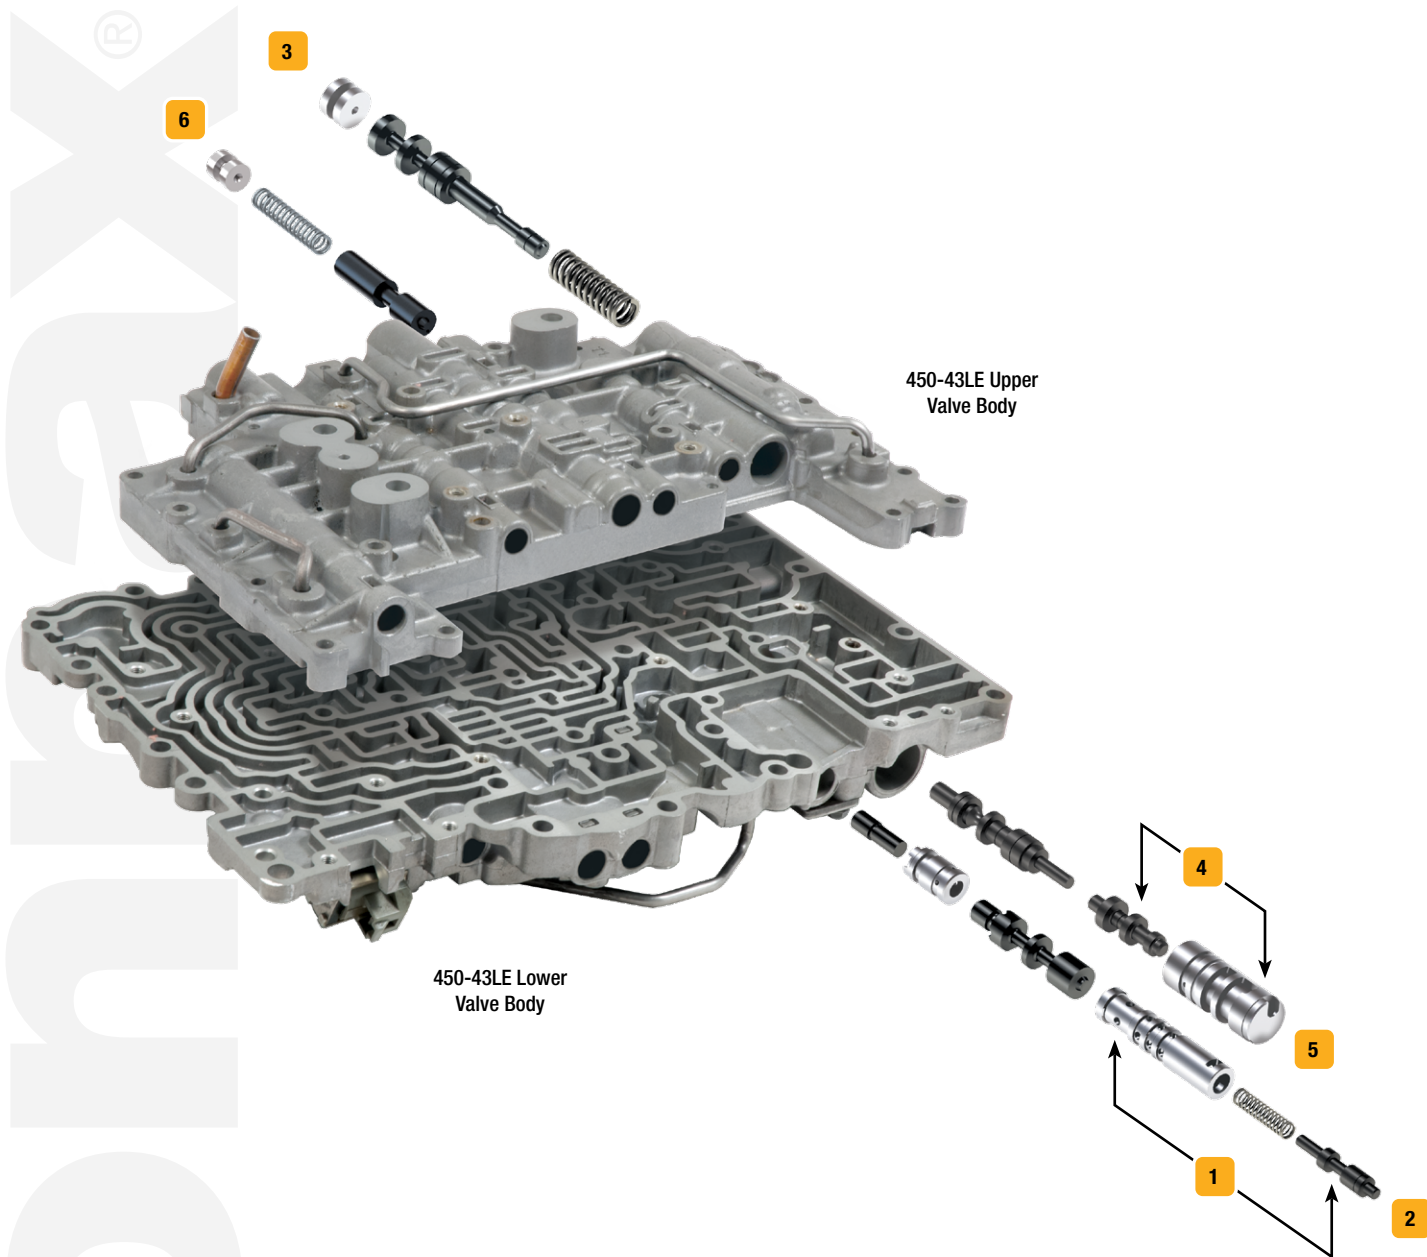

Symptoms/Benefits	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
TCC/Lockup Symptoms					
Engine stall on engagement, TCC apply concerns, Broken sleeve, Low line pressure	Cutback Valve Kit	1 94987-01K	ZIP		
TCC apply & release concerns, TCC codes, Engine stall on engagement, Broken sleeve	Oversized Lockup Control Valve & Cutback Valve Kit	2 94987-05K	Fits units with modulated TCC apply systems		F-94987-TL5*
Overheating, Loss of power, Bushing failure, Planetary failure	Oversized Secondary Regulator Valve Kit	3 94987-17K			F-94987-TL17*
Pressure Problems					
Delayed Reverse, Flare shifts, Clutch distress, Low line rise	Boost Valve Kit	4 94987-09K	ZIP		
Delayed engagement, Soft shifts, Low line pressure, High line pressure, Harsh shifts	Oversized Pressure Regulator & Boost Valve Kit	5 94987-11K			F-94987-TL11‡
No 3rd & 4th, No lockup, Low line pressure, Delayed Forward, 2-3 Flare	Oversized Solenoid Modulator Valve Kit	6 94987-14K			F-94987-TL14*

* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.