


# Aisin AW 450-43LE

Parts shown here fit '98-later models of Isuzu NPR, GMC Forward Tiltmaster, Chevrolet Forward, Nissan UD and Mitsubishi Fuso trucks.



Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

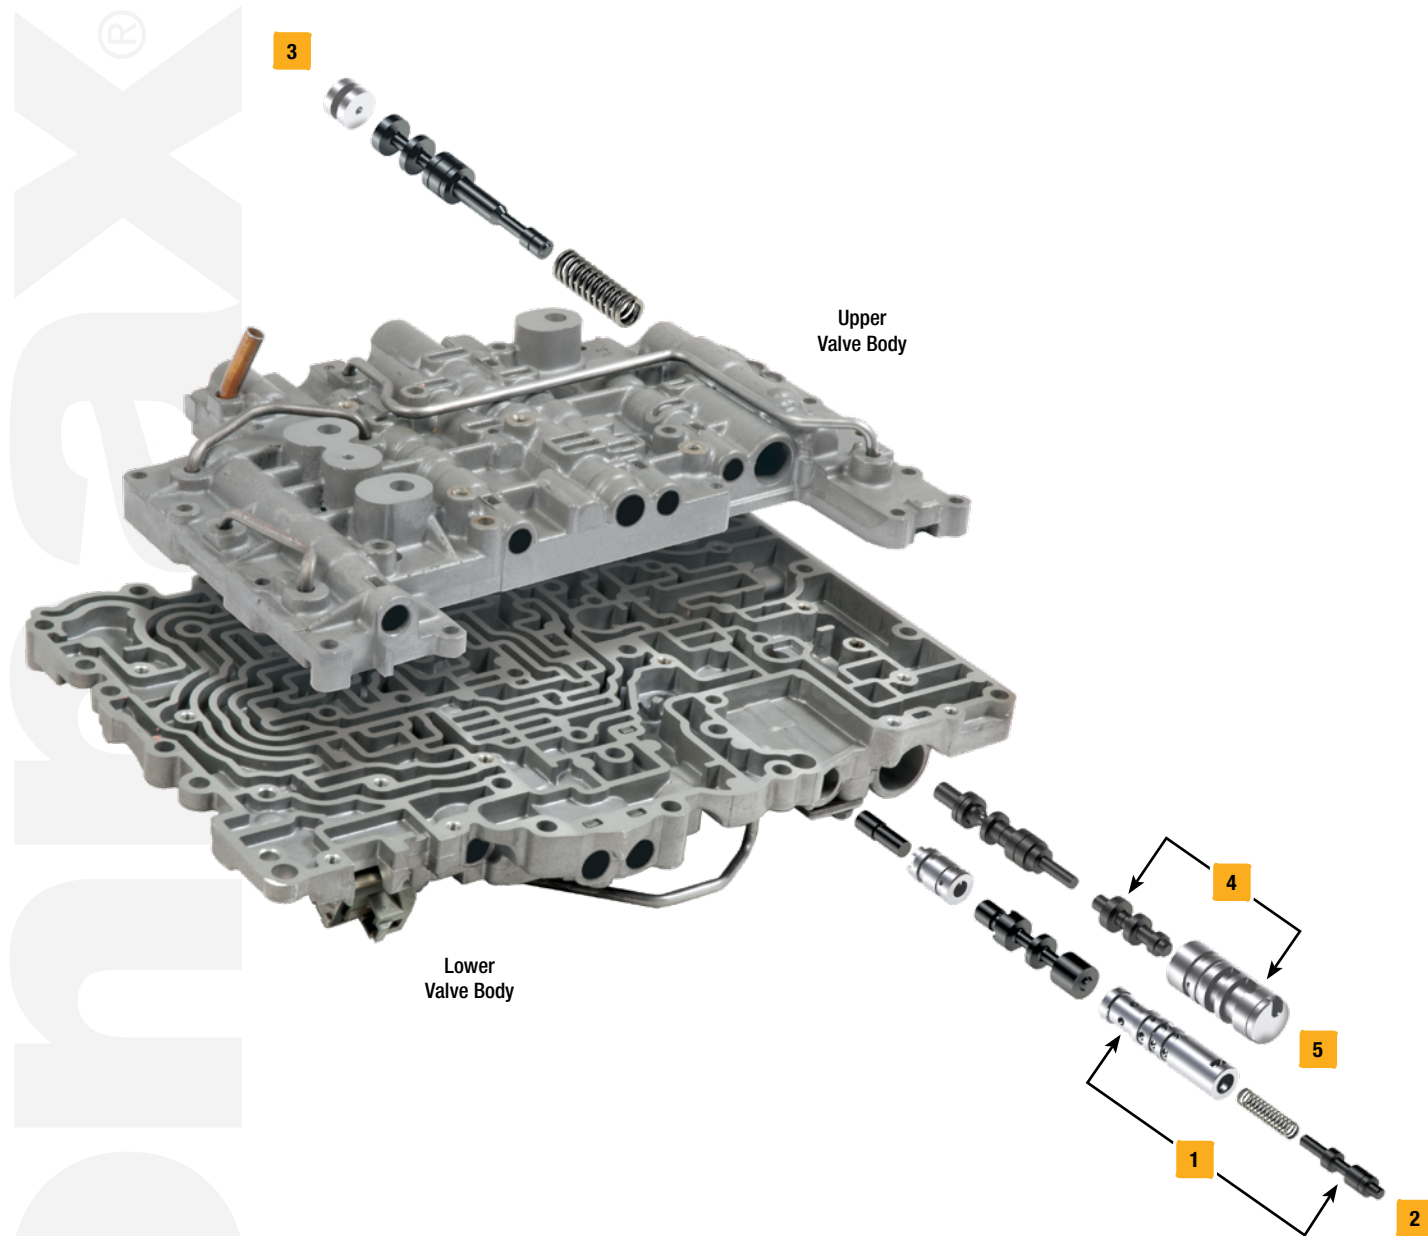

Symptoms/Part Type	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
<b>TCC/Lockup Symptoms</b>					
Engine stall on engagement, TCC apply concerns, Broken sleeve, Low line pressure	Cutback Valve Kit	<b>1</b> 94987-01K	ZIP		
TCC apply & release concerns, TCC codes, Engine stall on engagement, Broken sleeve	Oversized Lockup Control Valve & Cutback Valve Kit	<b>2</b> 94987-05K	Fits units with modulated TCC apply systems		F-94987-TL5*
Overheating, Loss of power, Bushing failure, Planetary failure	Oversized Secondary Regulator Valve Kit	<b>3</b> 94987-17K			F-94987-TL17*‡
<b>Pressure Problems</b>					
Delayed Reverse, Flare shifts, Clutch distress, Low line rise	Boost Valve Kit	<b>4</b> 94987-09K	ZIP		
Delayed engagement, Soft shifts, Low line pressure, High line pressure, Harsh shifts	Oversized Pressure Regulator & Boost Valve Kit	<b>5</b> 94987-11K			F-94987-TL11*

\* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.