


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

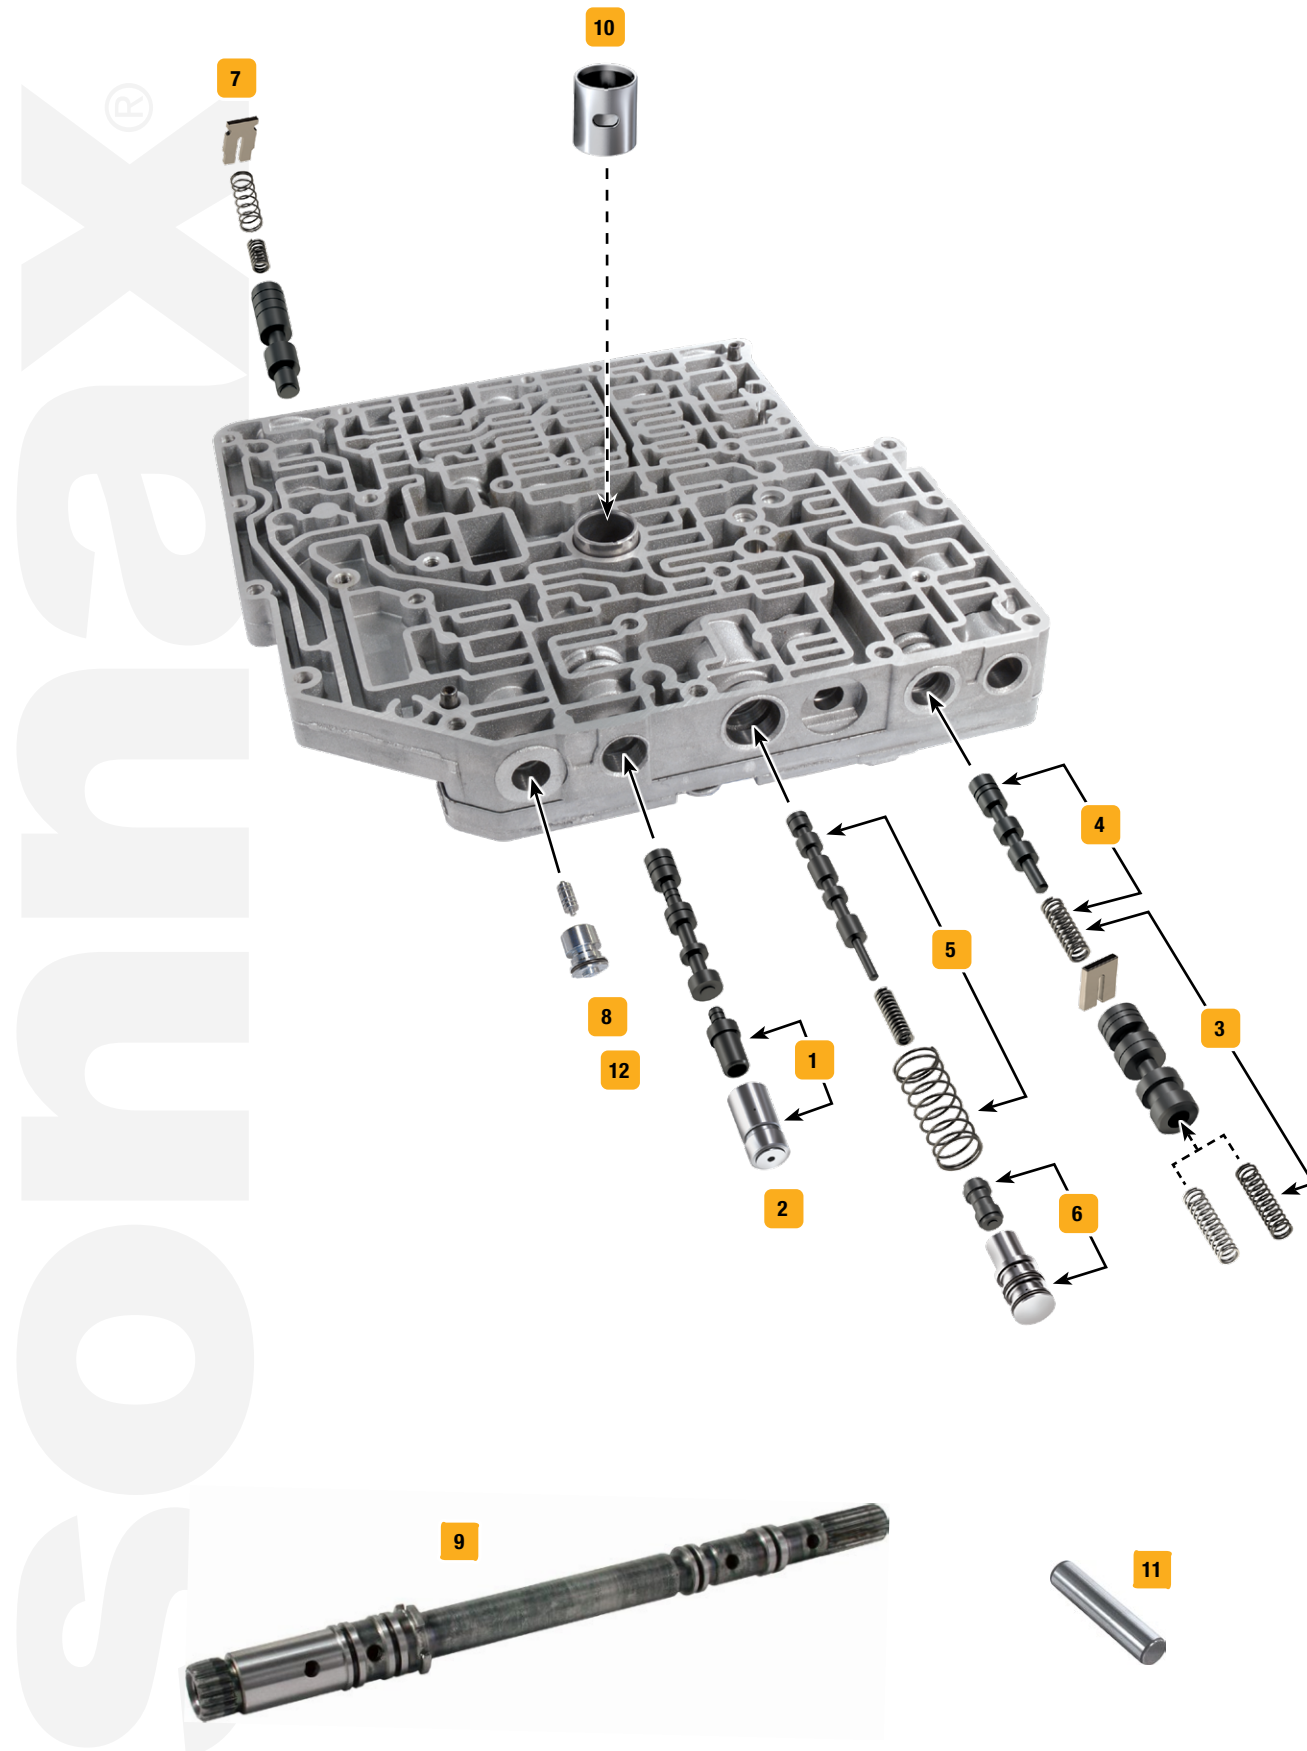

Symptoms/Benefits	Product Name	Part No.	Details	Tooling
TCC/Lockup Symptoms				
Code 628, TCC cycling, TCC surge, No lockup, Lube failures, Excess cooler circuit oil loss	Bypass Clutch Control Plunger Valve Kit	1 96206-03K	ZIP .486" OE large spool dia.	
	Bypass Clutch Control Plunger Valve Kit	1 96206-13K	ZIP .496" OE large spool dia.	
Code P0741, TCC shudder, TCC cycling, Excess TCC slip, TCC apply & release concerns	Oversized Bypass Clutch Control Valve Kit	2 96206-05K		96206-TL‡
Code 628, 741, 744, TCC cycling, Overheating & reduced lube feed, Delayed engagement, No 4th	Oversized Converter Regulator Valve Kit	3 96201-23K	Works in 2- or 4-spooled OE applications	F-96201-TL23*‡
Code 1741, 1744, TCC cycling, No lockup, TCC surge	Oversized Solenoid Regulator Valve Kit	4 96201-21K		96201-TL2‡
Pressure Problems				
Erratic line pressure, Delayed engagement, Pump noise, Pump rotor & cover damage	Oversized Pressure Regulator Valve Kit	5 96206-10K	Late-style	96206-TL2
Shift/Engagement Concerns				
1-2 Flare, 2-3 Flare, 2-1 Clunk, Harsh Reverse, Clutch failure, Band failure	Boost Valve Kit	6 96201-01K	ZIP Fits all except 3.0 liter 12 valve, .491" dia. valve, includes O-rings	
	Boost Valve Kit	6 96201-08K	ZIP Fits all except 3.0 liter 12 valve, .491" dia. valve, factory style sleeve	
	Boost Valve Kit	6 96201-12K	ZIP Fits 3.0 liter 12 valve, .475" dia. valve, includes O-rings	
Coastdown Neutral after 4th Gear, No Forward, No 4th, Burnt Forward clutch	Forward Control Valve Kit	7 96206-07K	ZIP	96206-BST †‡
Intermittent harsh shifts, 1-2 Soft, 2-3 Soft, Low line rise, Low EPC pressure	Line Pressure Modulator Plunger Valve Kit	8 96948-01K	ZIP AX4N only, .427" valve dia.	
Component Damage/Failure				
Scored shaft	Oil Pump Shaft	9 96855-02K	Patented design increases oil flow	
Lost or damaged component	Pump Shaft Sleeve	10 96201-18		
	Pump Slide Pin	11 96200-02	5/Bag	
High Performance/Heavy Duty Upgrades				
Significantly firmer shifts at any gear	Line Pressure Modulator Plunger Valve Kit	12 96948-05K	ZIP AX4N only, extreme heavy duty, .500" dia.	

* VB-FIX Required

† Recommended Tool

‡ No longer in production. Check with your distributor for availability.