


# Aisin AW TF-60SN

These parts also fit Mini 6F21WA and VW/Audi 09G, 09K, 09M.



Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

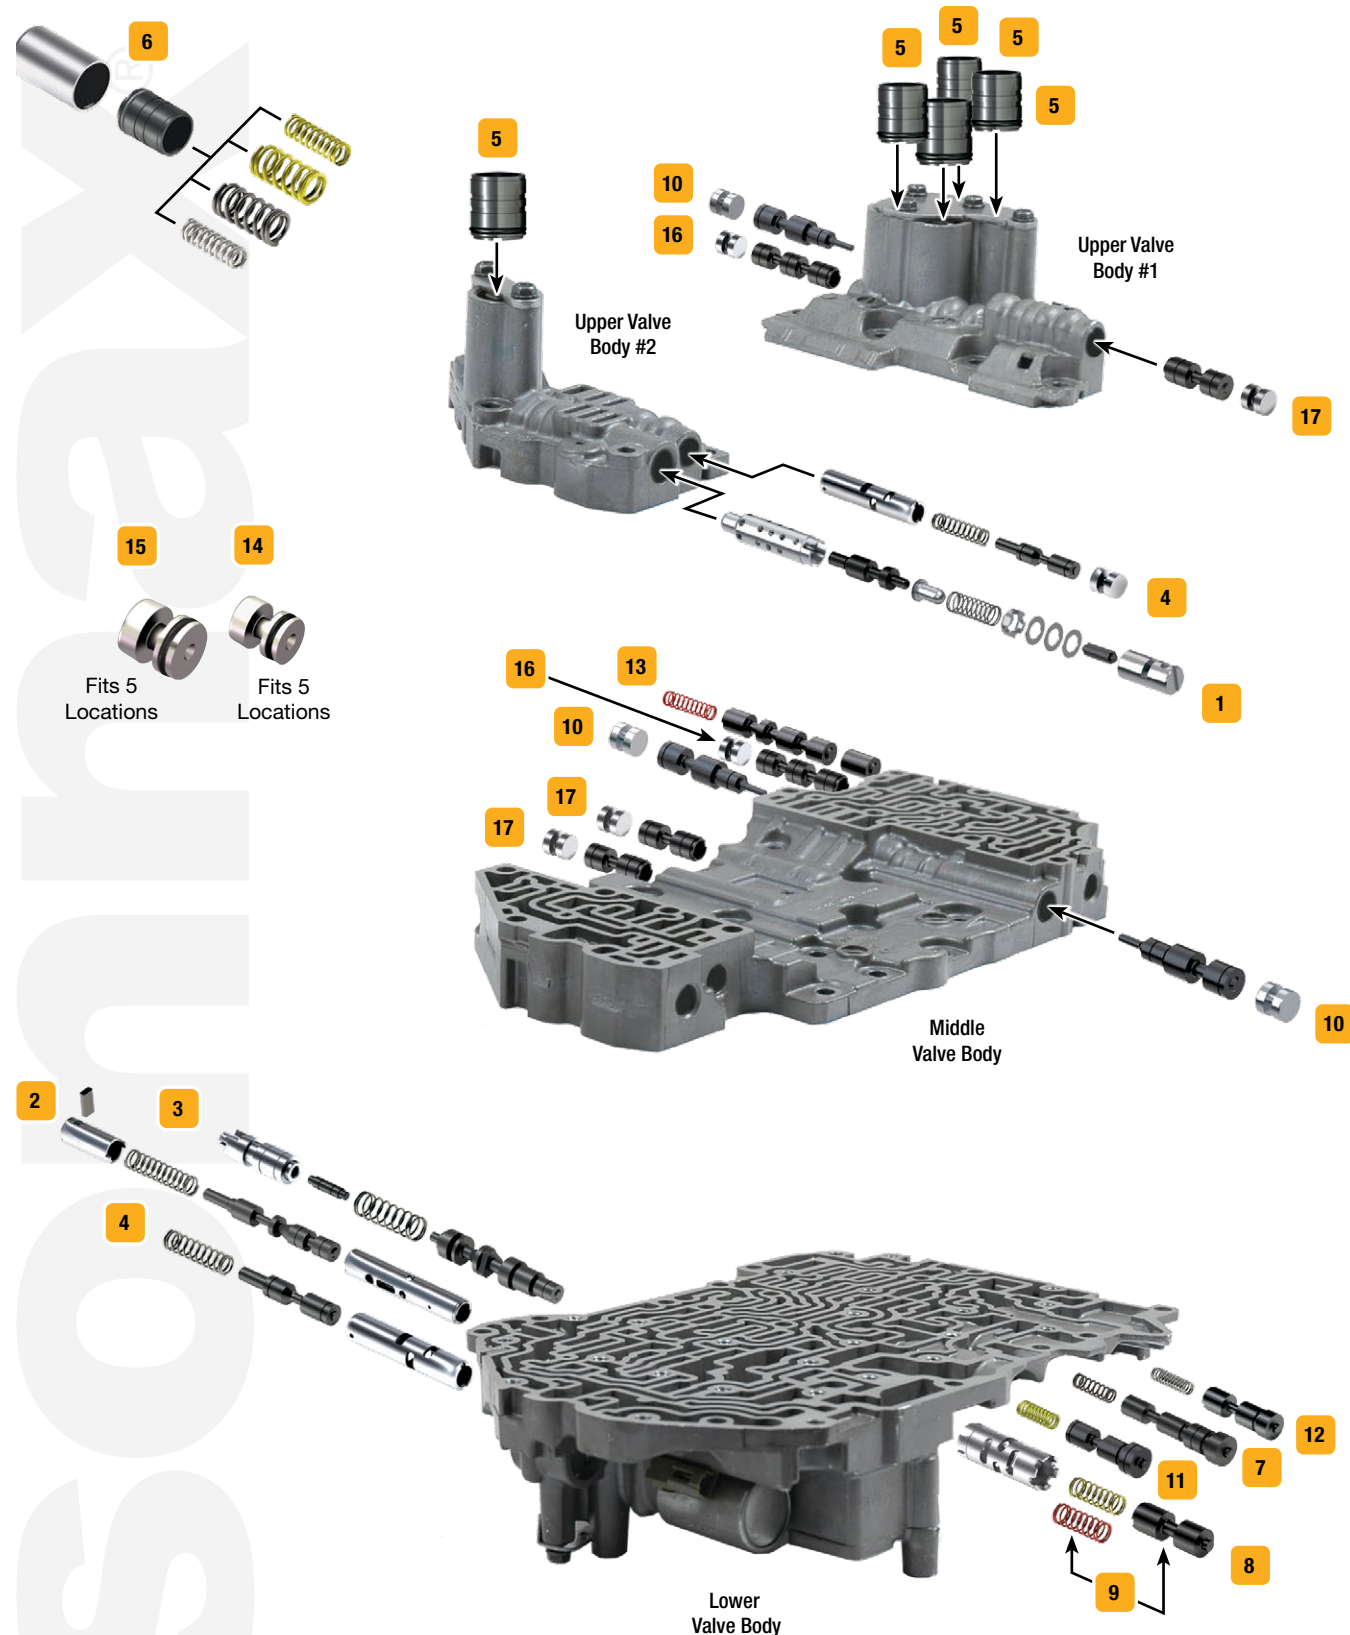

Symptoms/Part Type	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
<b>TCC/Lockup Symptoms</b>					
TCC codes, TCC apply & release concerns, RPM surge on light acceleration, Harsh downshifts	Lockup Clutch Control Valve Kit	1 15741-29K	Also fits Volvo (AM6), Opel (AF40), Peugeot (TF80), Saab (AF40/6), LandRover (TF80), Ford (AF21), Mazda (AW6A-EL)		F-15741-TL29*, F-15741-TL29PL*
TCC codes, TCC apply & release concerns, TCC slip, TCC surge	Secondary Pressure Regulator Valve Kit	2 15741-11K			15741-TL11
<b>Pressure Problems</b>					
Low line rise in Drive, Low line rise in Reverse, High line pressure in Reverse	Oversized Pressure Regulator Valve & Boost Valve Kit	3 15741-01K			F-15741-TL*
Code 734, 735, 729, Kickdown slip, Kickdown shock, 4th Slip, 5th Slip, 6th Slip	Solenoid Modulator Valve Kit	4 15741-18K	Fits either of 2 locations		F-15741-TL18*, F-15741-TL29PL*
<b>Shift/Engagement Concerns</b>					
Poor shift quality, Forward slip, Delayed engagement, Burnt clutches	Accumulator Piston Kit	5 15741-14K	ZIP Fits any of 5 locations		
Severe wear at accumulator bores, Low clutch oil pressure, Low TCC pressure	Accumulator Piston Kit	6 39741-42K	ZIP Fits any of 5 locations, includes selective springs		
1-2 Flare, 5-6 Flare, 2nd Slip, 6th Slip, Gear ratio & solenoid codes, B1 Clutches burned	Oversized B1 Clutch Control Valve Kit	7 15741-61K			F-15741-TL61*
Coastdown Neutral, Delayed Forward, Gear ratio & solenoid codes, K1 Clutch burned	C1/K1 Clutch Control Valve Kit	8 15741-25K	Valve, spring & sleeve, includes selective springs		F-15741-TL25*
C1 Clutch burned, K1 Clutch burned, Coastdown Neutral, Delayed Forward, Erratic shift timing	Oversized C1/K1 Clutch Control Valve Kit	9 15741-55K	Valve & spring		F-15741-TL55*
Erratic shift timing, Failsafe mode, Harsh shifts, Burnt clutches, Overheated fluid	Oversized Clutch Cutoff Valve Kit	10 15741-63K	Fits 3-4 transition bore, K3 relay bore & 4-5 timing bore		F-15741-TL63*
Erratic shift timing, Flare shifts, Harsh shifts, K2 Clutch burned	Oversized K2 Clutch Control Valve Kit	11 15741-57K	Valve & spring		F-15741-TL57*
2-3 Shift concerns, 4-5 Concerns, Delayed Reverse, Gear ratio & solenoid codes	Oversized K3 Clutch Control Valve Kit	12 15741-59K			F-15741-TL59*
Gear ratio & solenoid codes, No 4th, No 5th, No 6th	Oversized Main Relay Valve Kit	13 15741-70K			F-15741-TL70*
Shift concerns associated with circuit pressure loss	O-Ringed End Plug Kit	14 15741-35K	ZIP 9mm, includes 5 end plugs		
	O-Ringed End Plug Kit	15 15741-36K	ZIP 11mm, includes 5 end plugs		
Gear ratio & solenoid codes, Various shift concerns, No shift	Oversized Three-Spool Relay/Control/Switch Valve Kit	16 15741-50K	Fits either of 2 locations		F-33741B-TL1*
	Oversized Two-Spool Relay/Signal Valve Kit	17 15741-49K	Fits any of 3 locations		F-33741B-TL1*

\* VB-FIX Required