


Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.



See kit components at [www.sonnax.com](http://www.sonnax.com).

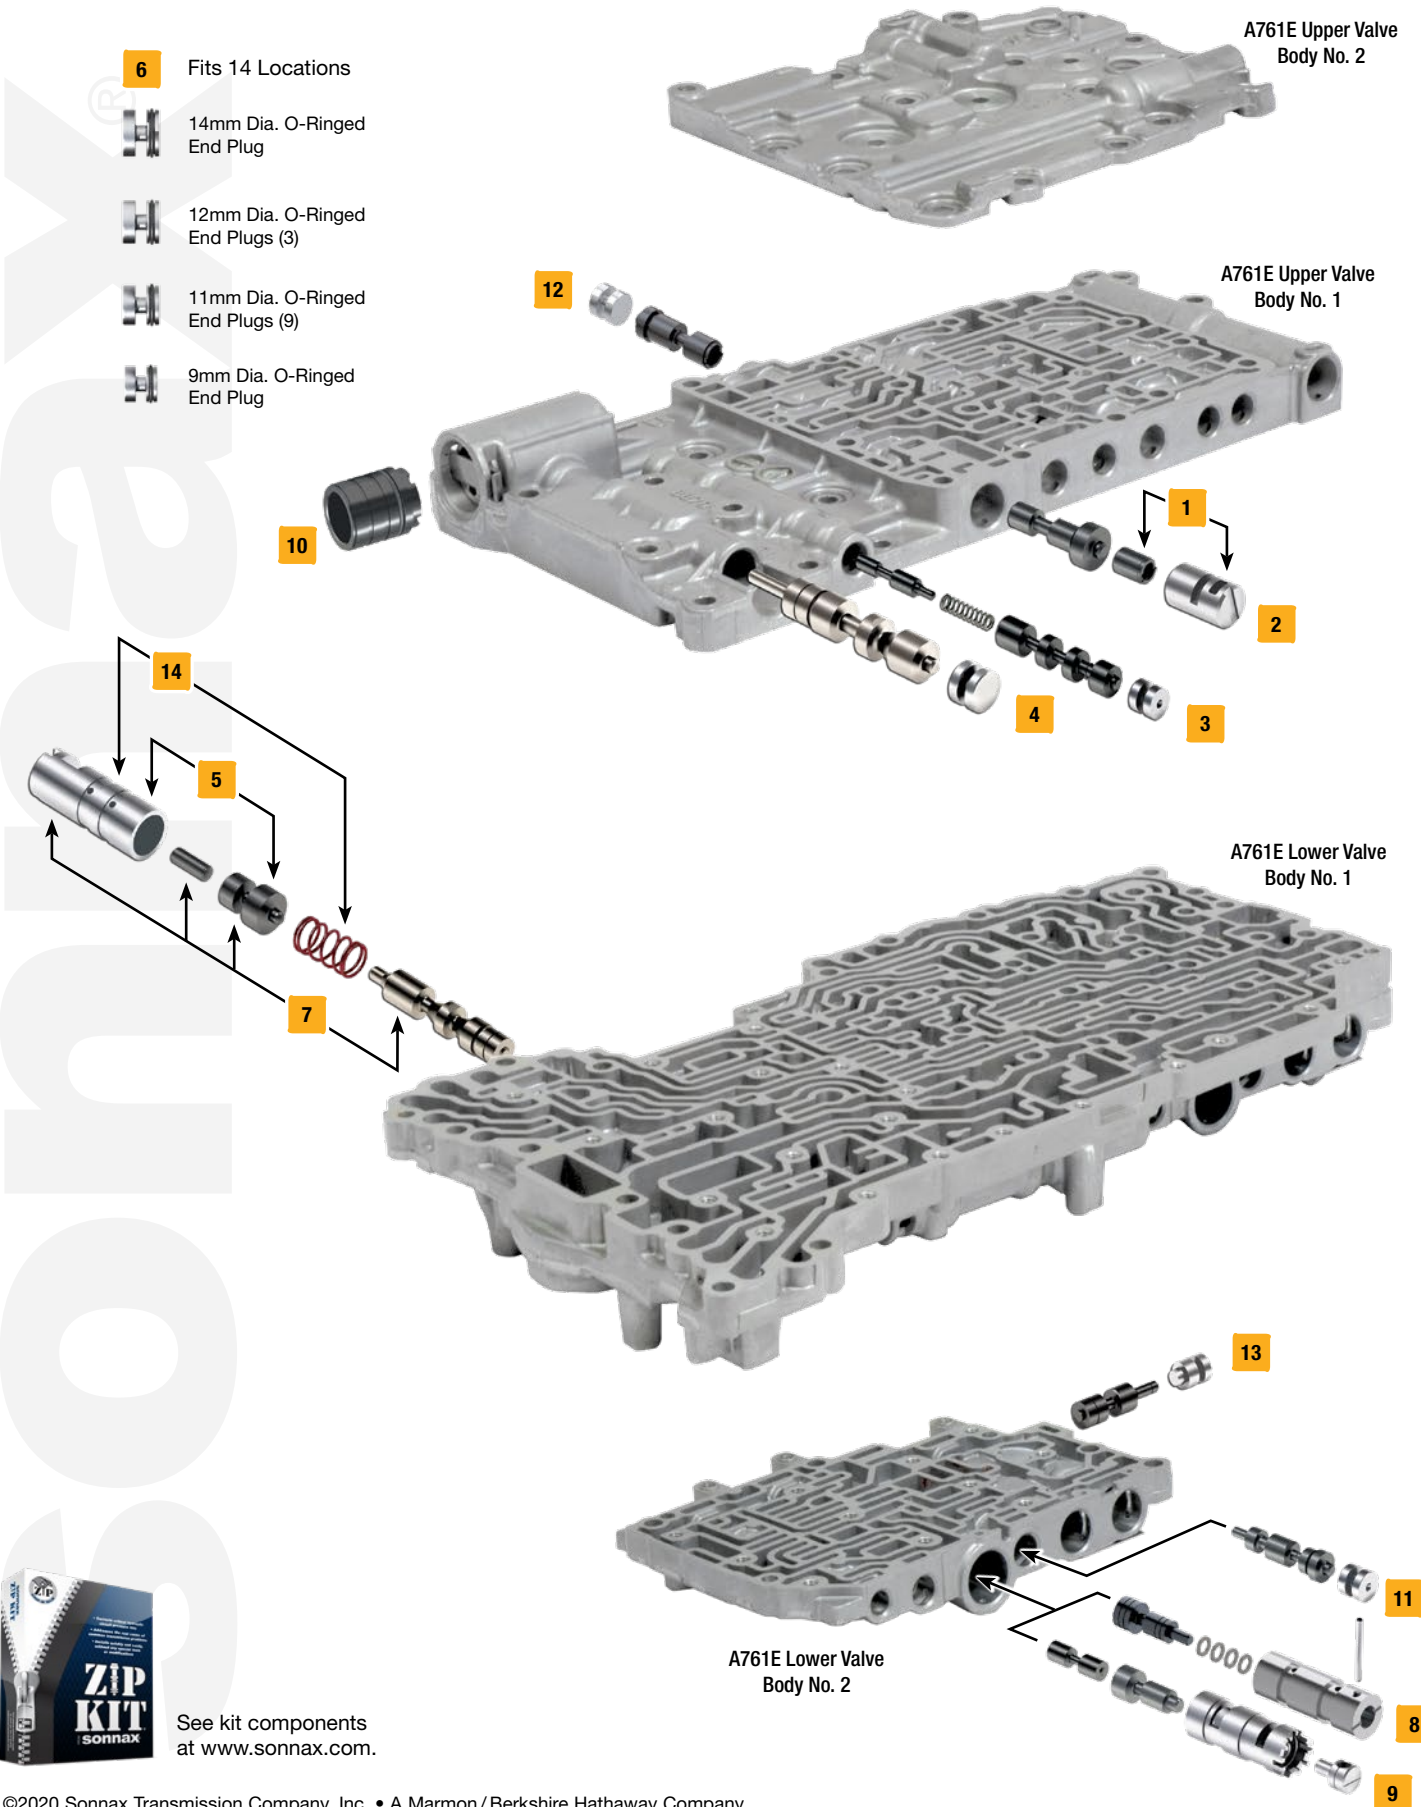

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
<b>Multiple Symptoms</b>				
The first step in correcting common shift problems	Zip Kit®	A750E-A761E-ZIP	ZIP	
<b>TCC/Lockup Symptoms</b>				
Harsh downshifts, TCC apply & release concerns, TCC codes, Cycling TCC RPM, Overheated fluid	Lockup Control Plunger Valve Kit	1 147741-37K	ZIP A761E, A960E/F only	
	Lockup Control Plunger Valve Kit	1 157740-37K	ZIP A760E/F/H, AB60E/F Only	
TCC apply & release concerns, Harsh downshifts, RPM fluctuation, TCC codes	Oversized Lockup Control Valve Kit	2 147741-16K	A761E, A960E/F only	F-147741-TL16*
	Oversized Lockup Control Valve Kit	2 157740-16K	A760E/F/H, AB60E/F only	F-157740-TL16*
TCC apply & release concerns, TCC apply codes, Burnt converter, Shudder, Overheating	Oversized Lockup Relay Valve Kit	3 147741-07K		F-147741-TL7*
Harsh lockup, TCC apply & release concerns, Burnt converter, Lube failures	Oversized Secondary Pressure Regulator Valve Kit	4 147741-10K		F-147741-TL4*
<b>Pressure Problems</b>				
Clutch failure, Soft shifts, Harsh shifts, High line pressure in Reverse, High line pressure	Boost Valve Kit	5 147741-01K	ZIP	
Clutch failure, Soft shifts, Harsh shifts, Low line pressure, High line pressure, Overheating	Oversized Main Pressure Regulator & Boost Valve Kit	7 147741-04K		F-147741-TL4*
Various concerns depending on location of leaking end plug, Pressure loss	O-Ringed End Plug Kit	6 147741-30K	ZIP Includes 14 end plugs	
<b>Shift/Engagement Concerns</b>				
Harsh shifts, Shift codes, Shift concerns	Accumulator Control Plunger Valve Kit	8 147741-43K	ZIP	
	Oversized Accumulator Control Valve Kit	9 147741-24K		147741-TL24
Delayed engagement, Flare shifts, Forward slip, Burnt clutches	Accumulator Piston Kit	10 57917E-19K		
Burnt clutches, Harsh shifts, Flare shifts, Shift concerns	Oversized Brake Control Valve Kit	11 147741-28K		F-147741-TL28*‡
Harsh upshifts, Harsh downshifts, Gear ratio codes, Flare shifts, Solenoid performance codes	Oversized Clutch Control Valve Kit	12 147741-14K		F-147741-TL14*
Solenoid performance codes, Bang shifts, TCC cycling, Shift concerns, Bind-up, TCC slip	Oversized Solenoid Modulator Valve Kit	13 147741-05K		F-147741-TL5*
<b>High Performance/Heavy Duty Upgrades</b>				
Classic, large-ratio boost valve for crisp, clean shifts without harshness	Line Pressure Booster Kit	14 A750-LB1		

\* VB-FIX Required

‡ No longer in production. Check with your distributor for availability.