


Click on part numbers for product details or visit www.sonnax.com to see all products for the unit(s) shown here.

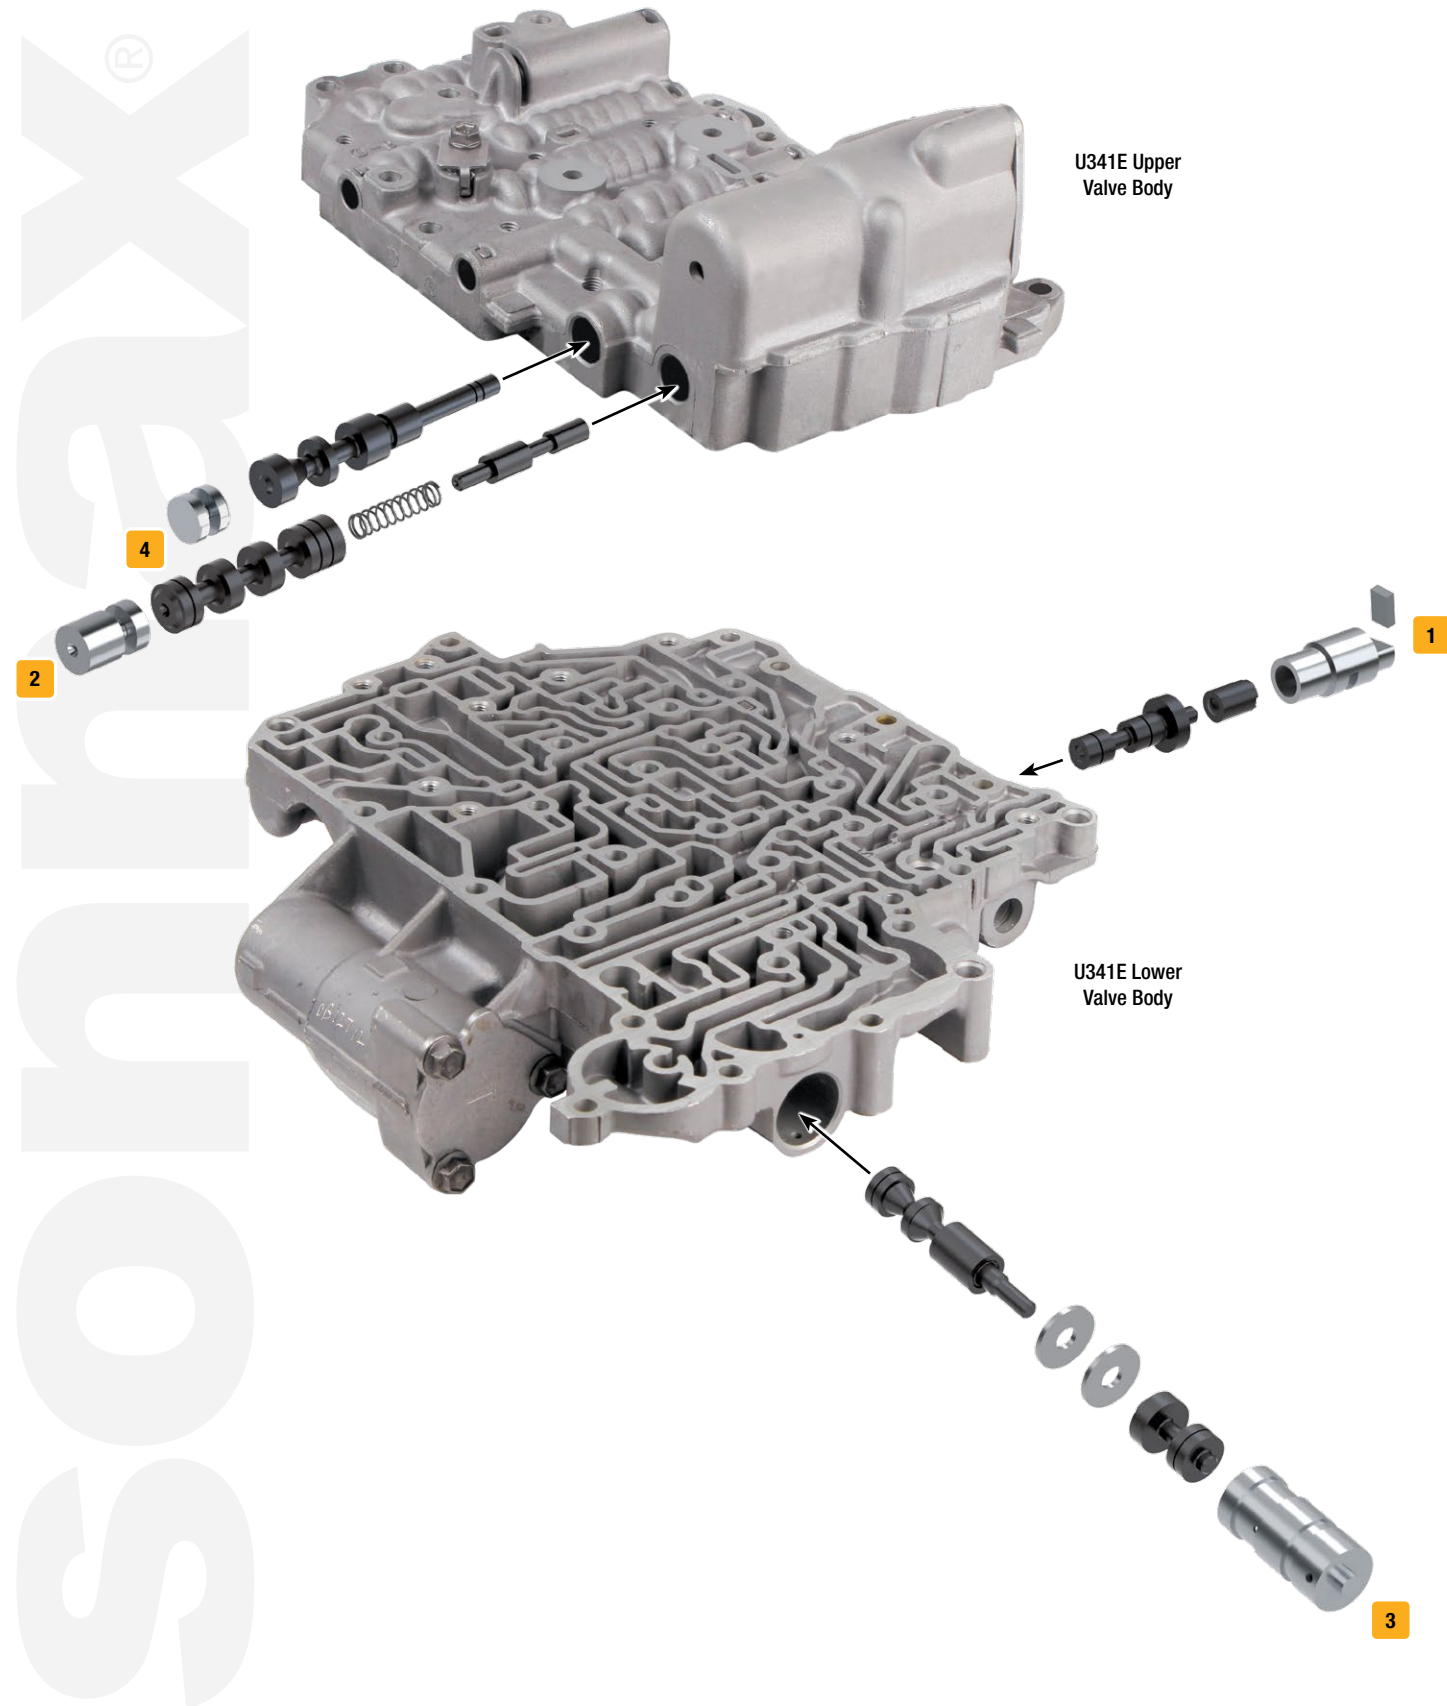

Symptoms/Part Type	Product Name	Part No.	Details	Tooling
TCC/Lockup Symptoms				
Converter shudder & TCC slip, Engine stall at idle, Harsh downshifts, No lockup, TCC codes	Oversized Lockup Control Valve Kit	1 37740-08K		F-37740-TL8*
Inadequate lubrication, Overheating, TCC apply & release concerns, TCC codes	Oversized Lockup Relay Valve Kit	2 37740-11K		F-37740-TL11*
Pressure Problems				
Burnt clutches, Delayed engagement, Erratic line pressure, Low line rise, Low Reverse boost	Oversized Pressure Regulator & Boost Valve Kit	3 37740-03K		F-37740-TL3*
Erratic TCC apply pressure, Excess TCC slip, Harsh TCC apply & release, TCC codes	Oversized Secondary Pressure Regulator Valve Kit	4 37740-07K		F-37740-TL7*

* VB-FIX Required