


Chrysler

# 45RFE, 545RFE, 65RFE, 66RFE, 68RFE

# sonnax®

2 Imtec Lane • Bellows Falls, VT 05101-0440 USA  
(800) 843-2600 • (802) 463-9722 • F: (802) 463-4059 • www.sonnax.com

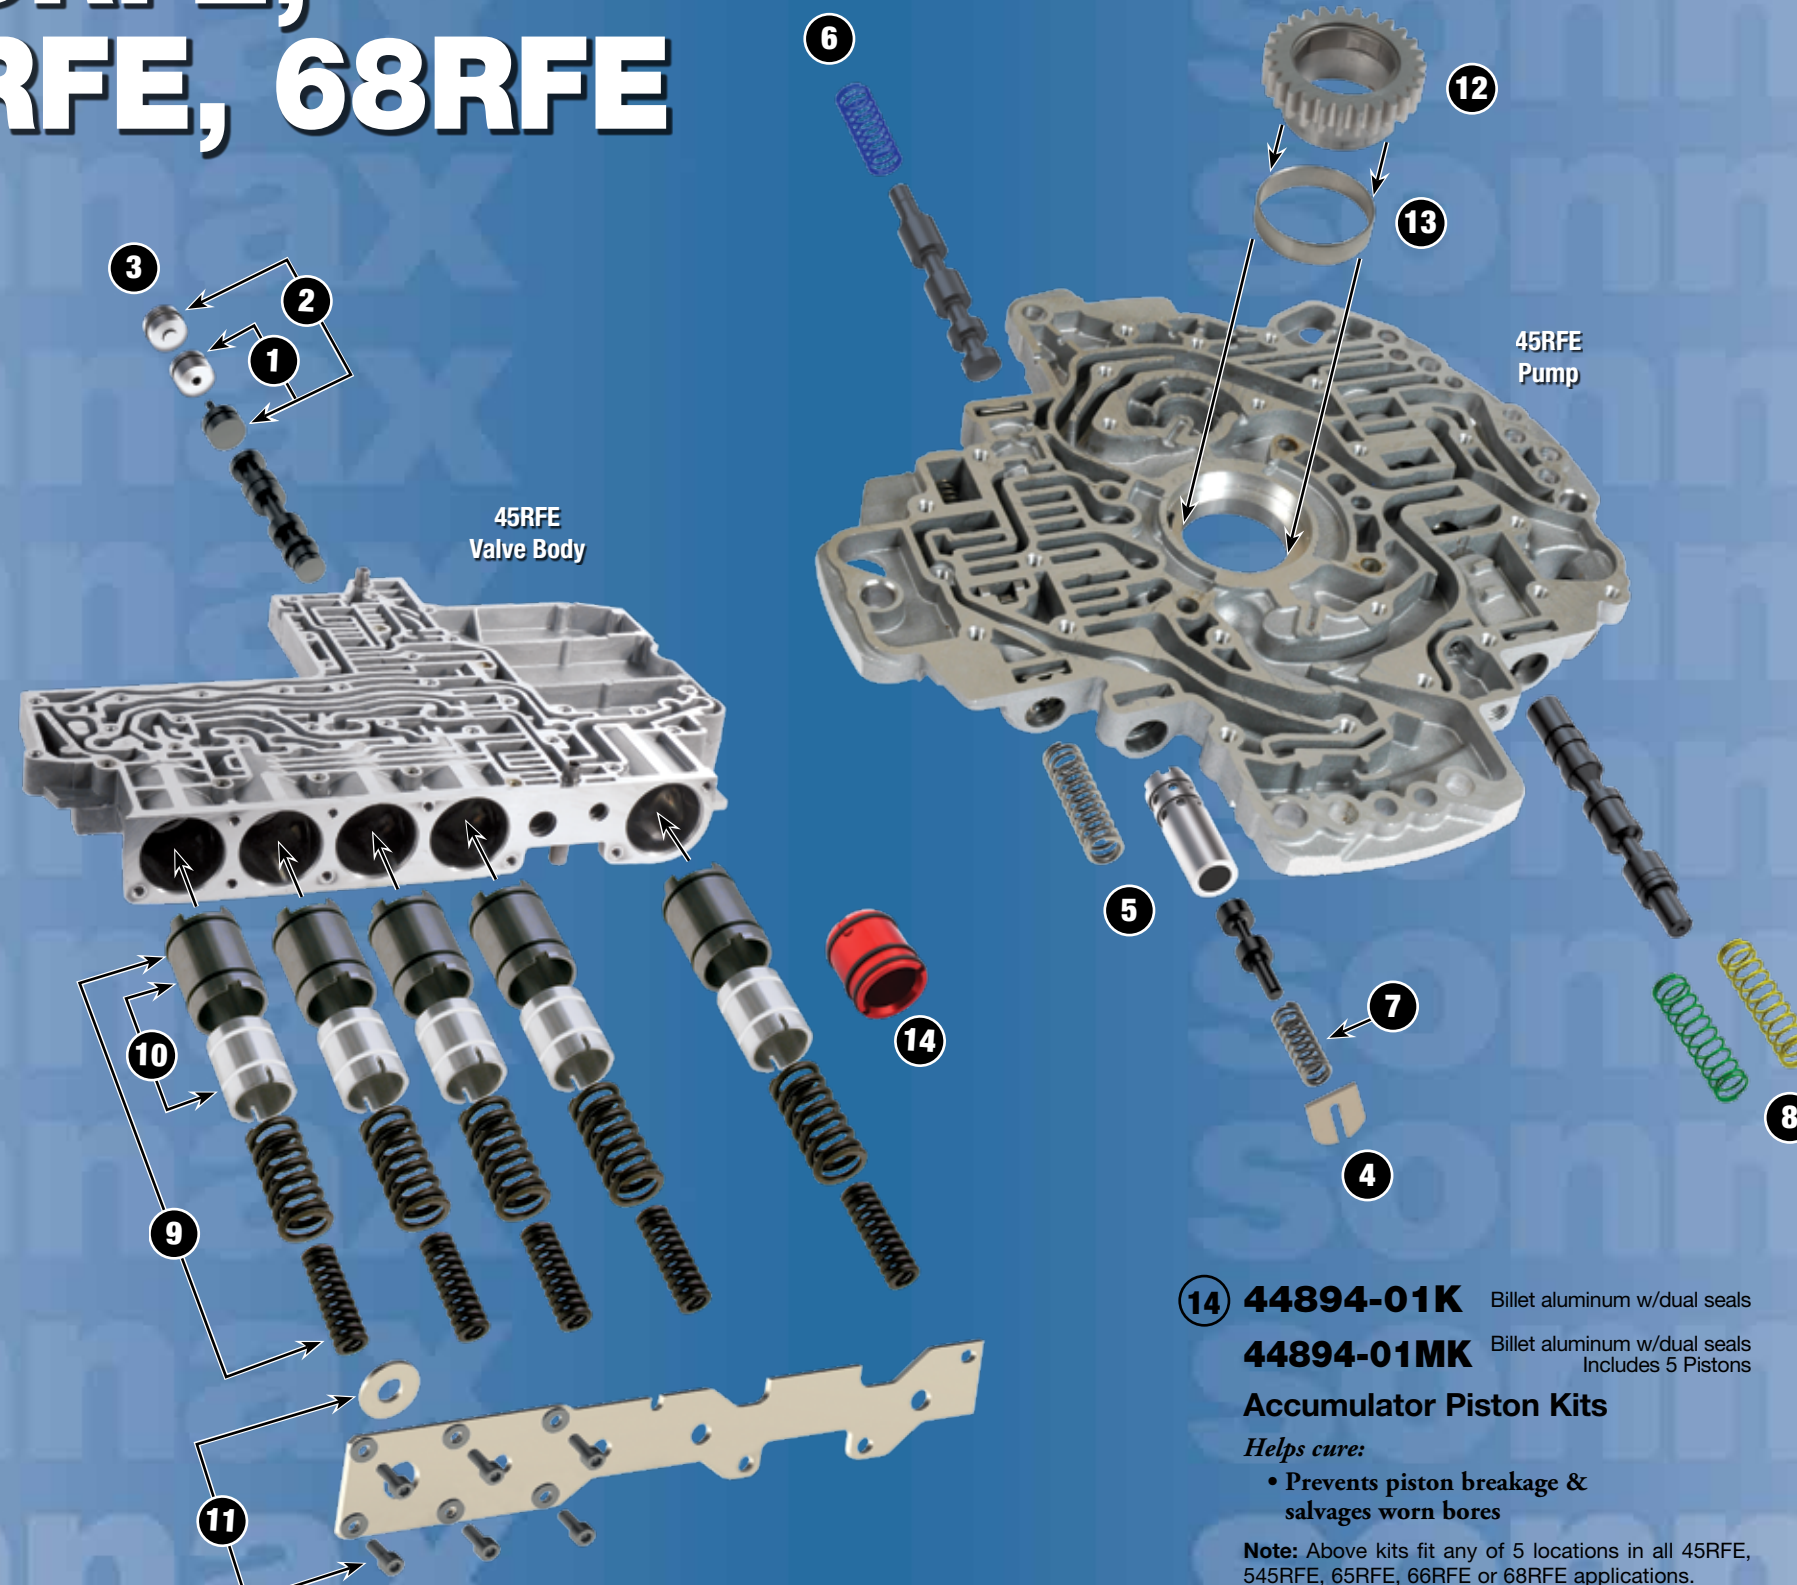

**1 92835-02K** .420" OE Dia Spool  
**Solenoid Switch Valve Plug Kit**

*Helps cure:*  
• Codes 841, 868, 871, 988, 1775, 1776  
• OD Clutch burned • Failsafe mode

**2 92835-22K** .453" OE Dia Spool  
**Oversized Solenoid Switch Valve Plug Kit**

*Helps cure:*  
• Codes 841, 868, 871, 988, 1775, 1776  
• OD Clutch burned • Failsafe mode

Note: 92835-22K Requires reamer 92835-RM22.

**3 92835-32K** .420" OE Dia Spool

**3 92835-31K** .453" OE Dia Spool  
**Oversized Solenoid Switch Valve & Plug Kits**

*Helps cure:*  
• Codes 841, 868, 871, 988, 1775, 1776  
• OD Clutch burned • Failsafe mode

Note: 92835-32K Requires tool kit F-92835-TL32; 92835-31K requires tool kit F-92835-TL31 & they both require the VB-FIX reaming fixture.

**4 44912-03K**  
**TC Limit Valve Kit**

*Helps cure:*  
• Delayed engagement • Loss of power  
• Engine Stall • Low TCC release pressure  
• Low cooler flow

Note: Requires tool kit F-44912-TL & the VB-FIX reaming fixture.

**5 44912-01** 5/Bag  
**TCC Accumulator Spring**

*Helps cure:*  
• Harsh TCC apply  
• TCC apply & release concerns

Click on Sonnax part numbers to see more information.

**14 44894-01K** Billet aluminum w/dual seals  
**44894-01MK** Billet aluminum w/dual seals Includes 5 Pistons  
**Accumulator Piston Kits**

*Helps cure:*  
• Prevents piston breakage & salvages worn bores

Note: Above kits fit any of 5 locations in all 45RFE, 545RFE, 65RFE, 66RFE or 68RFE applications.



This Sonnax kit is also available, see www.sonnax.com for details.  
**Line Pressure Booster Kit**  
RFE-LB1

**6 44912-08K**  
**Oversized TCC Switch Valve Kit**

*Helps cure:*  
• No lockup • Engine stall • TCC slip  
• Overheating • TCC codes

Note: Requires tool kit F-44912-TL8 & the VB-FIX reaming fixture.



**7 44912-02** 5/Bag  
**TCC Converter Limit Spring**

*Helps cure:*  
• Broken spring • Delayed engagement  
• Engine stall on engagement

**8 44912-10K**  
**Oversized Pressure Regulator Valve Kit**

*Helps cure:*  
• Harsh shifts • Erratic line pressure  
• Broken parts due to excessive line pressure

Note: Requires tool kit F-44912-TL10 & the VB-FIX reaming fixture.



**9 92834-05K** OE Shift Quality Includes Springs

**10 92834-03K** Firmer than OE Shift No Springs Included

**Accumulator Piston & Sleeve Kits**

*Helps cure:*  
• Slide shifts • High CVIs  
• 1-2 Shudder • Coastdown clunk

Note: Above kits fit any of 5 locations in 45RFE & 545RFE applications only.

**11 44892-01K**  
**Accumulator Cover Plate Kit**

*Helps cure:*  
• Damaged accumulator plate  
Note: Requires tool kit 44892-TL.



**12 72530B-02** 68RFE Only  
**Center Pump Gear**

**13 72530B-03** 68RFE Only, Precision  
**Center Pump Gear Bushing**

*Helps cure:*  
• Pump gear wear or fracture  
• Noise concerns