


Click on part numbers for product details or visit [www.sonnax.com](http://www.sonnax.com) to see all products for the unit(s) shown here.

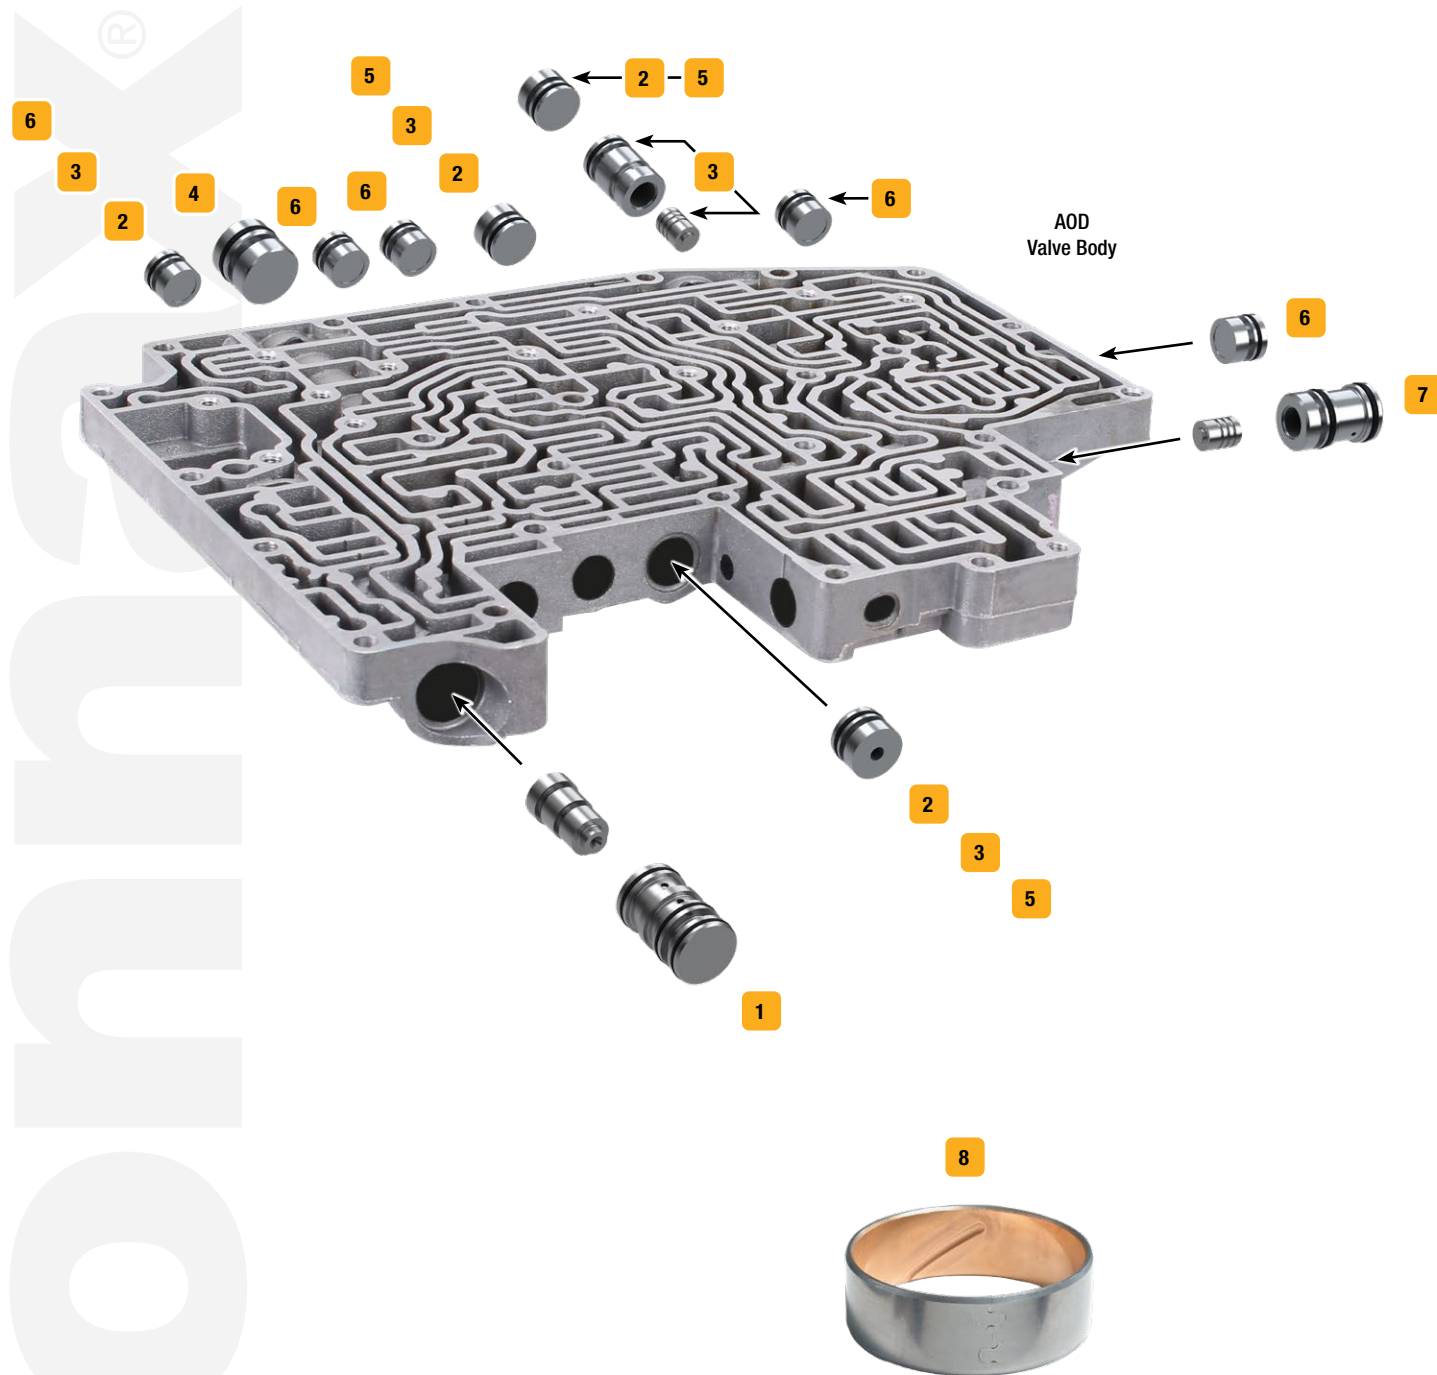

Symptoms/Part Type	Product Name	Part No.	Details	ZIP Drop-In Zip Valve™ Parts	Tooling
<b>Pressure Problems</b>					
Pressure loss, Converter drain back	Relief Valve	1 10000-01K	Low radius, 10/bag		
<b>Shift/Engagement Concerns</b>					
Soft slide shifts, Delayed Reverse, Low line rise, Direct clutch failure	Boost Valve Kit	2 76990K	ZIP O-Ring style, OE ratio		
	Boost Valve Kit	2 76990-03K	ZIP Factory style, OE ratio		
	Boost Valve Kit	2 76990-04K	ZIP Factory style, large ratio		
Erratic shift timing, Oil leaks	Governor Circuit End Plug Kit	3 76999-04K	ZIP Mid '83-earlier, includes 3 medium & 1 small end plugs		
	Governor Circuit End Plug Kit	4 76999-05K	ZIP Mid '83-later, includes 2 medium & 1 small end plugs, a 3-4 shift sleeve & valve assembly		
	O-Ringed End Plug Kit	5 76999-LRG	ZIP Large, includes 3 end plugs		
	O-Ringed End Plug Kit	6 76999-MED	ZIP Medium, includes 3 end plugs		
Uncontrollable shift timing, Low line rise, Overheated clutch, Overheated band	O-Ringed End Plug Kit	7 76999-SML	ZIP Small, includes 3 end plugs		
	Throttle Valve Plug Kit	8 76989K	ZIP O-Ring style		
Throttle Valve Plug Kit	8 76989-03K	ZIP Factory style			
<b>Component Damage/Failure</b>					
Leaking front seal, Pump noise, Excess converter hub-to-bushing clearance, Low pump volume	Pump Bushing	9 36002-01	Finish-in-place		