


ZF6HP19 Audi: A4 '08

GPM/HZ

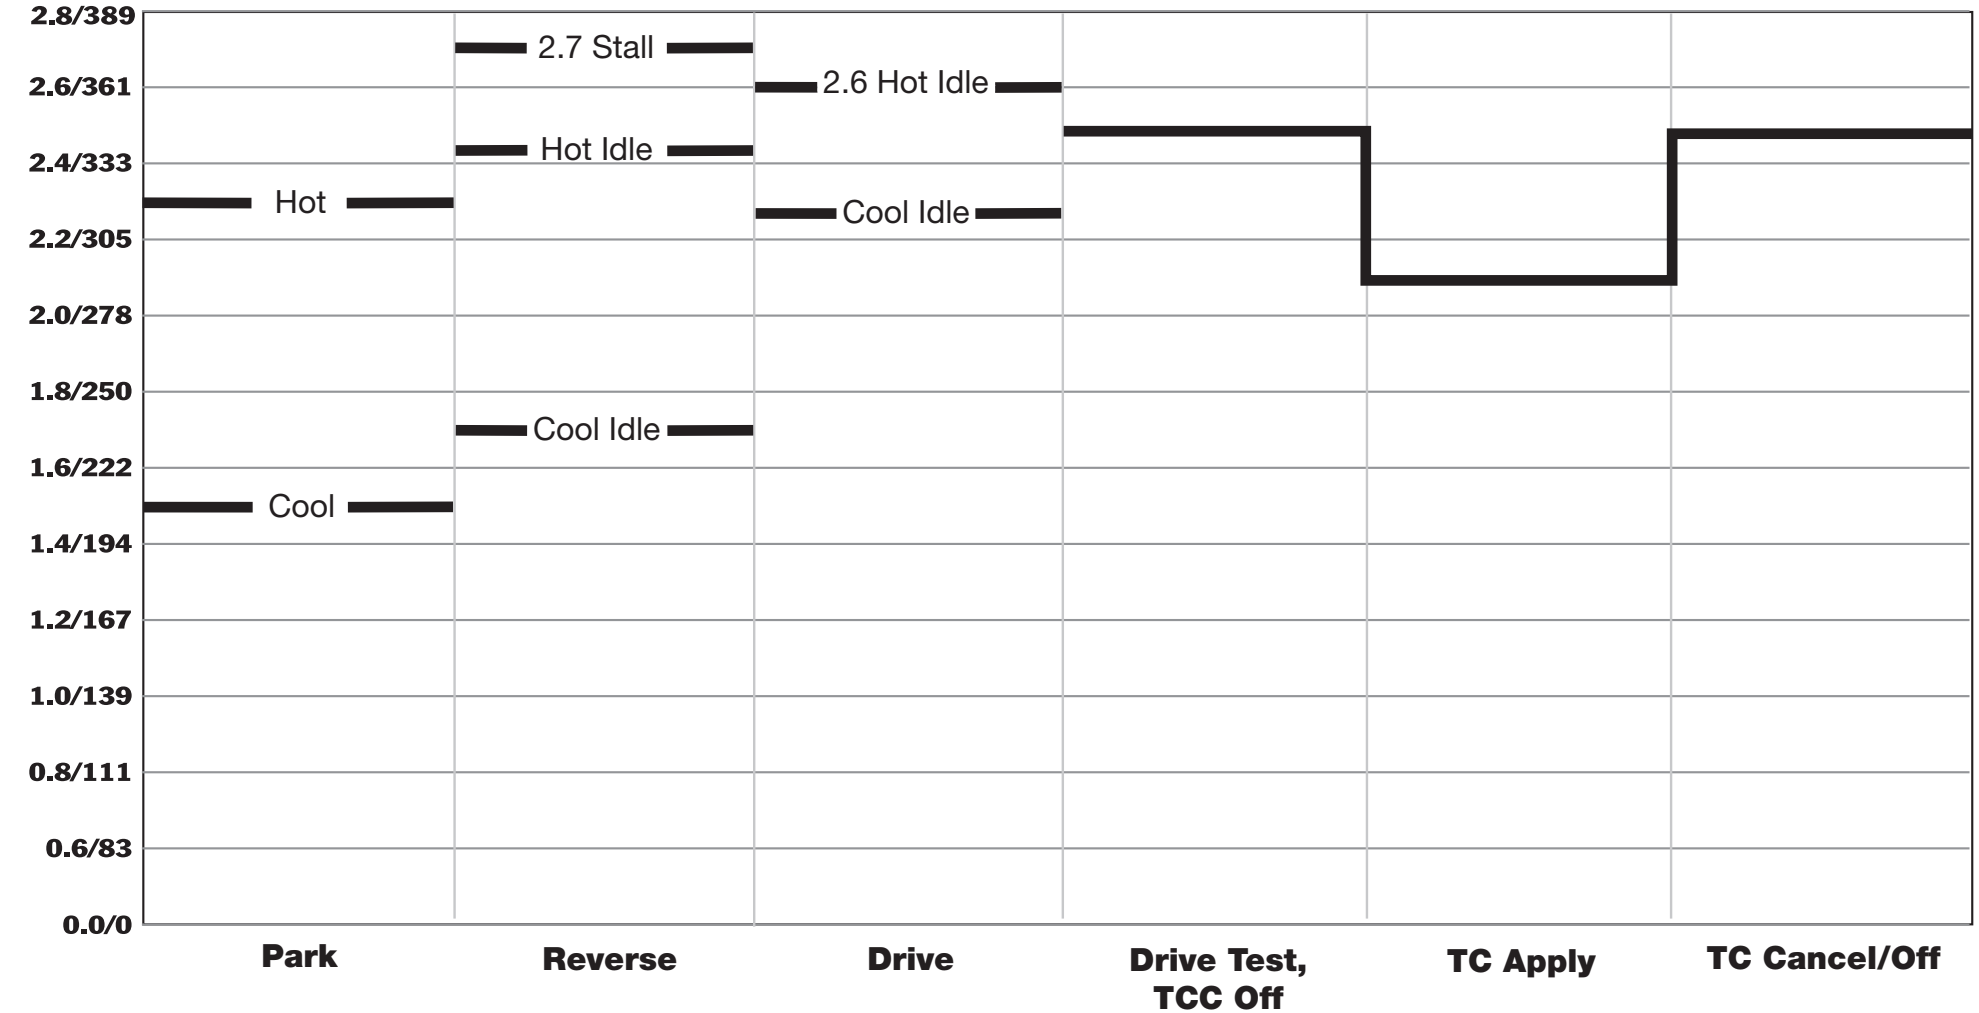

Condition: Normal

Notes: TCC locks up generally after 1-2 shift. Using graphing scope, you will see slight control open/slip during upshifts. TC does not release on coastdown 6, 5, 4 or 4-3. Tap into WK pressure as well. WK goes to 0-2 psi upon Apply.